STRAINER TYP 942S

CHARACTERISTIC:

Diameter - 15 -125 mm; Pressure - 250 bar; Temperature - up to 600°C;

Medium - water, steam and other non-toxic, non aggressive media and engine fuel,

sea water.

VERSIONS: type / body material / others


Example: 942S / --Example: 942S / U


Body material	Sign
(P250GH) C 22.8	
16Mo3	U
13CrMo4-5	Α
11CrMo9-10	В
14MoV6-3	С

Others	Sign
Standard – without drain plug	

APPLICATION:

Strainers are used to protect the pipeline and its equipment from impurities. The strainer stop every mechanical impurities bigger then mesh size. The strainers can be made with drain plug for special order.

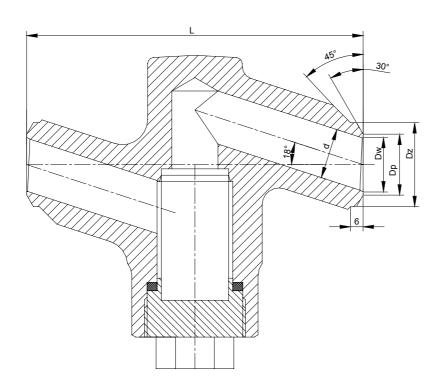

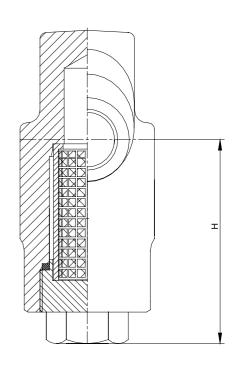



FABRYKA ARMATURY PRZEMYSŁOWEJ

"WAKMET" spółka jawna

Kaczmarek, Krzywdziński, Wachowski, Wilczyński **Bodzanów 75 48-340 GŁUCHOŁAZY 1** tel.+48(077) 439-40-20, fax +48(077) 439-18-72

E-mail: wakmet@wakmet.com.pl http: www.wakmet.com.pl

MATERIALS:

Versions	Standard	U	Α	В	С							
Parts	T _{MAX} 450°C	T _{MAX} 530°C	T _{MAX} 560°C	T _{MAX} 600°C	T _{MAX} 570°C							
Body , bonnet	(P250GH) C22.8 (1.0460)	16Mo3 (1.5415)	13CrMo4-5 (1.7335)	11CrMo9-10 (1.7383)	14MoV6-3 (1.7715)							
Strainer		X6CrNiTi18 10 (1.4541)										
Gasket		Grafit + austenite										

Special materials on request; modifications reserved.

DIMENSIONS:

Standard – butt weld ends								
DN	d	Dz	Dw	L	Weight	н		
15	14	22	16	160	4,00	97		
20	20	28	19,5	160	4,00	97		
25	24	35	26,5	160	4,00	97		
32	32	44	32,5	300	15,00	200		
40	38	50	38,5	300	15,00	200		
50	48	62	45	300	15,00	200		
65	62	77	59,5	340	26,50	220		
80	76	117	93	380	55,50	243		
100	92	144	116,5	430	71,00	271		
125	112	172	138,5	500	91,00	-		

Dimensions in mm: modifications reserved.

The height of strainers depend from precision of filter.

TECHNICAL DATA:

							Mov	imal wo	kina pro	oouro ot	working	tomporo	turo					
Body material	PN	20°C	100°C	150°C	200°C	250°C								530°C	540°C	560°C	570°C	600°C
Dody material		20°C 100°C 150°C 200°C 250°C 300°C 350°C 400°C 450°C 480°C 500°C 520°C 530°C 540°C 560°C 570°C 600°C 570°C 600°C 570°C 600°C 600°C																
(P250GH)C																		
22.8	250	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	165,0	-	-	-	-	-	-	-	-
(1.0460)																		
16Mo3	250	250.0	250.0	250.0	250.0	250.0	250.0	250.0	250.0	250.0	222.0	176.0	141.0	112.0	_	-	_	_
(1.5415)		,-	,-	,-	,-	,-	,-	,-	,-	,-	,	,.	, .	, -				
13CrMo4-5 (1,7335)	250	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	224,0	186,0	146,0	95,0	79,0	-
14MoV6-3 (1.7715)	250	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	205,0	174,0	-
11CrMo9-10 (1.7383)	250	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	250,0	246,0	215,0	186,0	138,0	122,0	81,0

Mesh

- 100 meshes/cm²; basic mesh size 0,6 mm standard
- 200 meshes/cm²; mesh size 0,35 mm;
- 400 meshes/cm²; mesh size 0,25 mm;
- 600 meshes/cm²: mesh size 0.1 mm.

MOUNTING AND OPERATING:

The valve can only be mounted and operated by skilled, properly trained and qualified personnel. Incorrect assembly or operation of the valve may have substantial impact on the entire system such as fluid leakage, reduction in system's function etc.

Before a strainer is installed the pipeline must be clean from any mechanical impurities. The compatibility of critical parameters of the flow must be checked with the parameters of the strainer. Strainer can be mounted to a pipe-line in horizontal position. The direction of the flow should only comply with the arrow marked on the body. The strainer should be cleaned every time a pipeline is stopped, after a repair and before heating season. In order to clean the strainer the bonnet must be taken off. The mesh can be washed with water under high pressure. Before the mesh is put in it must be dry. The strainer should be operated strictly with its assign.